

NDIR GAS ANALYZER FOR HEAT TREATMENT FURNACES

DATA SHEET ZFG-4

OVERVIEW

This gas analyzer (ZFG) is capable of measuring the concentrations of CO₂, CO and CH₄ components in sample gas. Compact and lightweight design is intended, and a maximum of 2 components are simultaneously measurable.

A high-sensitivity mass flow sensor is used in the detector unit of infrared method. Due to use of single beam system for measurement, maintenance is easy and an excellent stability is ensured for a long period of time.

In addition, a large sized liquid crystal display is provided for easier operation.

This analyzer is thus optimum for combustion control of various heat treatment furnaces.



- Compact and lightweight design is intended, and a maximum of 2 components are simultaneously measurable; 2 components selected from among CO₂, CO and CH₄.
- A high stability mass flow sensor is used in the detector;
 The original optics (measurement block) minimizes drift particularly due to contamination of a measuring cell, so an excellent stability is ensured for a long period of time.
- Subdued interference from other gas components; Interference from other gas components is insignificant, because
 the detector is a serial dual-layer type transmission detector.
- 4. Easy maintenance; Because of single-beam system, the measurement block is simple with no need for optical balance adjustment. Therefore, maintenance is easy.
- Easy to operate; Operation can be carried out smoothly in an interactive way through a large-size liquid crystal display.
- 6. Abundant functions;
 - Zero/span can be accurately calibrated just by pressing the calibration keys.
 - An error will be detected by self-diagnostic function and indicated by error message.
 - Besides, a rich variety of functions are provided including CP calculation value output, remote range changeover input, range discrimination signal output and output signal holding.



SPECIFICATIONS

Standard Specifications

Measuring system:

Non-dispersive infrared absorption method with single light source and single beam (single beam method)

Measurable gas components and measuring range:

	Min. measuring range	Max. measuring range
CO ₂	0 to 0.5%	0 to 100vol%
СО	0 to 0.5%	0 to 100vol%
CH ₄	0 to 1%	0 to 10%

- Max. 2 components measurable
- 2 ranges selectable
- Measuring range ratio ≤ 1:5 max

Measured value indication:

Digital indication in 4 digits (LCD with back light, Automatic OFF function)

- Instantaneous value of each component
- Result display for CP calculation (optional)
 Display language: Japanese or English selectable

Analog output signals:

4 to 20mA DC, 0 to 1V DC, 0 to 10mV DC or 0 to 100mV DC Non-isolated output

Analog output corresponds to measured value indiction in 1:1.

Allowable load resistance:

4 to 20mA DC 550 Ω or less0 to 1V DC, 0 to 100mV DC, or 0 to 10mV DC, 100k Ω or more

Contact output:

1a relay contact (250V AC/2A, resistive load) Instrument error (standard), range identification signal (optional) All rlay contacts are isolated mutually from the internal circuit.

Contact input (optional):

No-voltage contact (ON/0V, OFF/5V DC, 5mA flowing at ON)Remote range changeover input, remote hold inputIsolated from the internal circuit with photocoupler. Contact inputs are not isolated from one another.

Power supply:

Rated voltage 100 to 240V AC Operating voltage 85 to 264V AC

Frequency; 50Hz/60Hz Power consumption; 50VA max.

Operation conditions:

Ambient temperature; -5 to 45°C

Ambient humidity; 95% RH or less, no condensation

Storage conditions:

Ambient temperature; -20 to 60°C

Ambient humidity; 95% RH or less, no condensation

Dimensions ($H \times W \times D$):

211 × 218 × 257 mm

Mounting dimensions:

Panel flash-mount type (vertical mounting on panel)

Weight:

About 5 kg

Finish color:

Off-white (Munsell 10Y7.5/0.5 or equivalent)

Enclosure:

Steel casing, for indoor use

Material of gas-contacting parts:

Gas inlet/outlet; SUS304, Sample cell; SUS304/neoprene rubber, Infrared-ray transmitting window; C_aF_2

Internal tubing; Toaron

Gas inlet/outlet:

Rc1/4 or NPT1/4 internal thread (as specified)

Purge gas flow rate:

1 L/min (to be purged as required)

External terminal:

Power terminal; M4 screw, Others; M3.5 screw

Performance

Repeatability:

Within ±0.5% of full scale

Linearity:

Max.±1.0% of full scale (max.±2.0% of full scale when range ratio is 1:4 or 1:5)

Zero drift:

Within ±2% of full scale/week

Span drift:

Within ±2% of full scale/week

Response time (for 90% FS response):

Within 10 seconds

Interference from other gas components:

Within ±2%

Warm-up time:

Approx. 30 minutes

Description of functions

Automatic OFF function (standard):

After OFF time is set, the LCD backlight automatically turns off when no key is operated. Press any key to turn on.

Output signal holding (standard):

By setting an output hold to ON, analog output signal is held in the value just before the manual calibration.

Instrument error contact output (standard):

When the main unit is abnormal, contact signal output is provided.

CP calculation (optional):

The carbon potential of carburizing furnace and conversion furnace are calculated using furnace temperature (fixed input value) and CO concentration value (fixed or measured value) while referring to CO₂ measured value.

Formula; $CP = \frac{CPS \times (PCO)^2}{K1 \times PCO_2}$

CPS ; Saturated carbon concentration (partial pressure)0.0028t-1.30 (800°C \leq t < 850°C0.0030t-1.47 (850°C \leq t < 950°C)

 $0.0034t-1.85 (950^{\circ}C \le t < 1000^{\circ}C)$

t ; Furnace temperature (°C)

PCO; CO concentration value (partial pressure)
PCO₂; CO₂ concentration value (partial pressure)
K1 ; Constant K1 = 10 (9.06 – 15966/T)
T ; Rankine temperature (t × 9/5 + 32 + 460)

Remote output holding (optional):

Output signal is held at the latest value or setting value by short-circuiting the remote output holding input terminals. Holding is maintained while the terminals are short-circuited. Indication values will not be held.

Remote range changeover (optional):

Range is selected by the contact input signal. Changeover is effective only when remote range setting is turned on. In this case, measuring range cannot be changed manually. When the contact input terminals for each component are short-circuited, the first range is selected, and it is changed over to the second range when the terminals are open.

Range identification signal (optional):

The present measuring range is identified by a contact signal. When the contact output terminals for each component are closed, the first range is selected, and it is changed over to the second range when the terminals are open.

Standard Requirements for measuring gases

Flow rate:

0.5L/min ± 0.2L/min or 1L/min ± 0.5L/min

Temperature:

0 to 40°C

Pressure:

5kPa or less (Gas outlet side should be open to the atmospheric air.)

Dust:

0.3µm or less

Mist:

Unallowable

Moisture:

Below a level where saturation occurs at room temperature (condensation unallowable).

Corrosive component:

HCL 1ppm or less

Standard gas for calibration:


Zero gas; Dry N2 or dry air

Span gas; Each sample gas having concentration 90 to 100% of its measuring range (recommended).
Unusable at concentrations beyond 100%.

Installation condition

- Mount the instrument in a place that is not subject to direct sunlight, weathering nor radiation heat from hightemperature objects.
 - If such a place cannot be found, a roof or cover should be prepared for protection.
- · Avoid a place where receives heavy vibration.
- Select a clean environment.
- Discharge the exhaust gas into atmospheric air at a safe location.
- Avoid using the analyzer in an explosion-proof area.


Standard gas sampling system

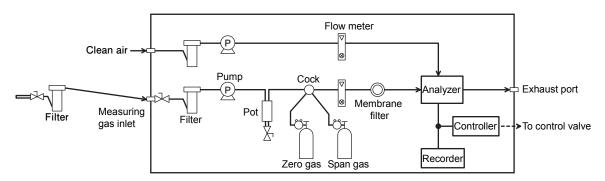

Note) This is the example of sampling which dose not contain water in the measuring gas.

Principle diagram of NDIR type measurement (For CO, CO₂, CH₄)

Quantity of infrared ray that is absorbed by the measuring cell is detected with the mass flow sensor.

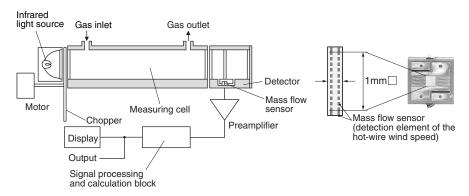

CODE SYMBOLS

		ZFG	G	4 5 F		8	9 10	11 ′	121	3]-[14 1: Y	5 16]	
Digit	Spec	ification] '	A A A	4 4	۰	A A	A.	<u> </u>	, ,	A 4	Ż	1	
4	Standard		\perp	Ė	Ш		Ш	1	Ц		Ц	Ц		
5	Measurable components	1st component 2nd component CO Without CO2 Without CH4 Without CO2 CO CH4 CO CO2 CO CH4 CO CO2 CH4		I B D E G H J										
6	Gas inlet/outlet connection	Rc1/4 NPT1/4	T	-	1		П	T	П		T	П		
7	Output signal	4 to 20mA DC 0 to 1V DC 0 to 100mV DC 0 to 10mV DC			1 2 3 4									
8	Modification No.					4	1	T	П		П	П		
9	1st component, 1st range (See the page 5)	0 to 0.5% 0 to 1% 0 to 2% 0 to 3% 0 to 5% 0 to 10% 0 to 20% 0 to 20% 0 to 25% 0 to 40% 0 to 50% 0 to 70% 0 to 100% Others					HJKQLMNVWPXRZ							
10	1st component, 2nd range (See the page 5)	Without 0 to 1% 0 to 2% 0 to 3% 0 to 5% 0 to 10% 0 to 20% 0 to 20% 0 to 25% 0 to 40% 0 to 50% 0 to 70% 0 to 70% O to 70% Others					Y J K C L N V Y F X F	1 (Q - 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1						
11	2nd component, 1st range (See the page 6)	Without 0 to 0.5% 0 to 1% 0 to 2% 0 to 3% 0 to 5% 0 to 10% 0 to 20% 0 to 25% 0 to 40% 0 to 50% 0 to 70% 0 to 70% 0 to 100% Others						Y H J K Q L M N V W P X R Z					r I	Note) See page 5 and 6 for the possible neasuring ranges to be manufactured. Table 1 to 3: Single-component analyzer Table 4 to 6: Two-component analyzer Note 1) Calibration curve varies with gas components contained in sample gas. A; standard adjustment" stands for adjustment
12	2nd range (See the page 6)	Without 0 to 1% 0 to 2% 0 to 3% 0 to 5% 0 to 10% 0 to 20% 0 to 20% 0 to 25% 0 to 40% 0 to 50% 0 to 70% 0 to 100% Others							Y J K Q L M N V W P X R Z				" ((t N	A, standard adjustment stands for adjustment in N2 balance. B; adjustment for heat treatment furnace" is applied to CO analyzer and CO2 analyzer. CO2 analyzer: CO2 range gas + 25% CO + 31% Hz/N2 CO analyzer: CO range gas + 5% CO2 + 31% Hz/N2 When "Z; other" is specified, a gas composition able should be attached. lote 2) When the 16th code is "B", the range code "X" and "R" are not available.
13	Display language	Japanese English							1	2				
14	Option	Without With CP calculation value output With Contact input/output With CP calculation value output + Contact input/output								í	Y A B C			
15 16	— Adjustment	— Standard	+									/ <u> </u> A		
10	(Note 1)	Standard Heat treatment furnaces (Note 2) Steel converter Others										E C	}	

Correspondence table of the possible measuring ranges

Table1: Single-component analyzer <CO₂>

	2nd range	Υ	J	K	Q	L	М	N	V	W	Р	Х	R
1st ra	ange	Without	0 to 1%	0 to 2%	0 to 3%	0 to 5%	0 to 10%	0 to 20%	0 to 25%	0 to 40%	0 to 50%	0 to 70%	0 to 100%
Н	0 to 0.5%	0	0	0	0	_	_	_	_	-	_	_	_
J	0 to 1%	0	-	0	0	0	-	-	-	-	-	-	-
K	0 to 2%	0	-	_	0	0	0	-	-	-	-	-	-
Q	0 to 3%	0	-	_	_	0	0	_	_	-	-	_	_
L	0 to 5%	0	-	_	_	_	0	0	0	-	-	-	_
M	0 to 10%	0	_	_	_	_	_	0	0	0	0	_	_
N	0 to 20%	0	-	_	-	_	-	-	0	0	0	0	0
V	0 to 25%	0	-	_	_	_	-	-	_	0	0	0	0
W	0 to 40%	0	-	_	_	_	-	-	_	-	0	0	0
Р	0 to 50%	0	-	_	_	_	-	-	_	-	-	0	0
Х	0 to 70%	0	_	_	_	_	_	_	_	_	_	_	0
R	0 to 100%	0	_	_	_	_	_	_	_	_	_	_	_

Table2: Single-component analyzer <CO>

2nd rang	e Y	J	K	Q	L	М	N	V	W	Р	Х	R
1st range	Without	0 to 1%	0 to 2%	0 to 3%	0 to 5%	0 to 10%	0 to 20%	0 to 25%	0 to 40%	0 to 50%	0 to 70%	0 to 100%
H 0 to 0.5%	0	0	0	0	_	-	_	-	-	-	_	-
J 0 to 1%	0	-	0	0	0	-	_	-	-	-	-	-
K 0 to 2%	0	-	_	0	0	0	-	-	-	-	-	-
Q 0 to 3%	0	_	_	_	0	0	-	_	-	-	-	_
L 0 to 5%	0	-	_	_	_	0	0	0	-	-	-	-
M 0 to 10%	0	-	_	_	_	-	0	0	0	0	-	-
N 0 to 20%	0	_	_	_	_	_	_	0	0	0	0	0
V 0 to 25%	0	_	_	_	_	-	-	_	0	0	0	0
W 0 to 40%	0	-	_	_	_	-	-	_	ı	0	0	0
P 0 to 50%	0	-	_	_	_	-	-	_	ı	ı	0	0
X 0 to 70%	0	_	_	_	_	_	_	_	_	_	_	0
R 0 to 100%		_	_	_	_	_	_	_	_	_	_	_

Table3: Single-component analyzer <CH₄>

	2nd range	Υ	K	Q	L	М	N	V	W	Р	Х	R
1st r	ange	Without	0 to 2%	0 to 3%	0 to 5%	0 to 10%	0 to 20%	0 to 25%	0 to 40%	0 to 50%	0 to 70%	0 to 100%
J	0 to 1%	0	0	0	0	-	-	-	-	-	-	-
K	0 to 2%	0	_	0	0	0	-	-	_	-	-	_
Q	0 to 3%	0	_	_	0	0	-	-	-	-	-	-
L	0 to 5%	0	_	_	-	0	0	0	-	-	-	_
M	0 to 10%	0	_	_	-	-	0	0	0	0	-	_
Ν	0 to 20%	0	_	_	-	-	-	0	0	0	0	0
V	0 to 25%	0	_	_	-	_	-	-	0	0	0	0
W	0 to 40%	0	_	_	-	_	ı	-	-	0	0	0
Р	0 to 50%	0	_	_	-	-	-	-	-	-	0	0
Х	0 to 70%	0	_	_	_	-	_	-	_	_	_	0
R	0 to 100%	0	_	_	_	_	-	-	_	_	_	_

Correspondence table of the possible measuring ranges

Table4: Two-component analyzer <CO₂/CO>

1st component <0	CO ₂ >						2nd co	mponent	<co></co>	1st ran	ge/2nd r	ange									
1st range/ 2nd range		0 to 0.5 /1%	0 to 1 /2%	0 to 1 /3%	0 to 2 /3%	0 to 2 /5%	0 to 3 /5%	0 to 5 /10%	0 to 10 /20%	0 to 10 /25%	0 to 20 /25%	0 to 20 /40%	0 to 20 /50%	0 to 25 /40%	0 to 25 /50%	0 to 40 /50%	0 to 40 /70%	0 to 50 /70%	0 to 50 /100%	0 to 70 /100%	0 to 100% /Without
Zilu range									-								ļ. ·	ļ			
	Code	HJ	JK	JQ	KQ	KL	QL	LM	MN	MV	NV	NW	NP	VW	VP	WP	WX	PX	PR	XR	RY
0 to 0.5/1%	HJ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 1/2%	JK	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 1/3%	JQ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 2/3%	KQ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 2/5%	KL	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 3/5%	QL	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 5/10%	LM	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 10/20%	MN	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 10/25%	MV	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/25%	NV	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/40%	NW	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/50%	NP	1	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 25/40%	VW	-	_	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 25/50%	VP	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 40/50%	WP	ı	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 40/70%	WX	-	_	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 50/70%	PX	_	_	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 50/100%	PR	ı	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 70/100%	XR	-	_	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 100%/Without	RY	-	_	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0


Table5: Two-component analyzer <CO₂/CH₄>

1st component <co2> 2nd component <ch4> 1st range/2nd range</ch4></co2>																		
1st component <0	O2>					2nd con	nponent <	CH4>	1st rang	ge/2nd r	ange							
1st range/ 2nd range		0 to 2 /3%	0 to 2 /5%	0 to 3 /5%	0 to 5 /10%	0 to 10 /20%	0 to 10 /25%	0 to 20 /25%	0 to 20 /40%	0 to 20 /50%	0 to 25 /40%	0 to 25 /50%	0 to 40 /50%	0 to 40 /70%	0 to 50 /70%	0 to 50 /100%	0 to 70 /100%	0 to 100% /Without
	Code	KQ	KL	QL	LM	MN	MV	NV	NW	NP	VW	VP	WP	WX	PX	PR	XR	RY
0 to 1/2%	JK	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 1/3%	JQ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 2/3%	KQ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 2/5%	KL	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 3/5%	QL	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 5/10%	LM	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 10/20%	MN	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 10/25%	MV	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/25%	NV	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/40%	NW	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/50%	NP	_			0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 25/40%	VW	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 25/50%	VP	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 40/50%	WP	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 40/70%	WX	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 50/70%	PX	-	_	_	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 50/100%	PR	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 70/100%	XR	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 100%/Without	RY	-	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0

Table6: Two-component analyzer <CH₄/CO>

Table6: Two	able6: Two-component analyzer <ch4 co=""></ch4>																			
1st component <	CH ₄ >						2nd co	mponent	<co></co>	1st rang	ge/2nd r	ange			·					
1st range/ 2nd range		0 to 1 /2%	0 to 1 /3%	0 to 2 /3%	0 to 2 /5%	0 to 3 /5%	0 to 5 /10%	0 to 10 /20%	0 to 10 /25%	0 to 20 /25%	0 to 20 /40%	0 to 20 /50%	0 to 25 /40%	0 to 25 /50%	0 to 40 /50%	0 to 40 /70%	0 to 50 /70%	0 to 50 /100%	0 to 70 /10%	0 to 100% /Without
	Code	JK	JQ	KQ	KL	QL	LM	MN	MV	NV	NW	NP	VW	VP	WP	WX	PX	PR	XR	RY
0 to 1/2%	JK	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 1/3%	JQ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 2/3%	KQ	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 2/5%	KL	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 3/5%	QL	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 5/10%	LM	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 10/20%	MN	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 10/25%	MV	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/25%	NV	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/40%	NW	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 20/50%	NP	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 25/40%	VW	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 25/50%	VP	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 40/50%	WP	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 40/70%	WX	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 50/70%	PX	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 50/100%	PR	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 70/100%	XR	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
0 to 100%/Without	RY	-	-	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0

OUTLINE DIAGRAM (Unit:mm)

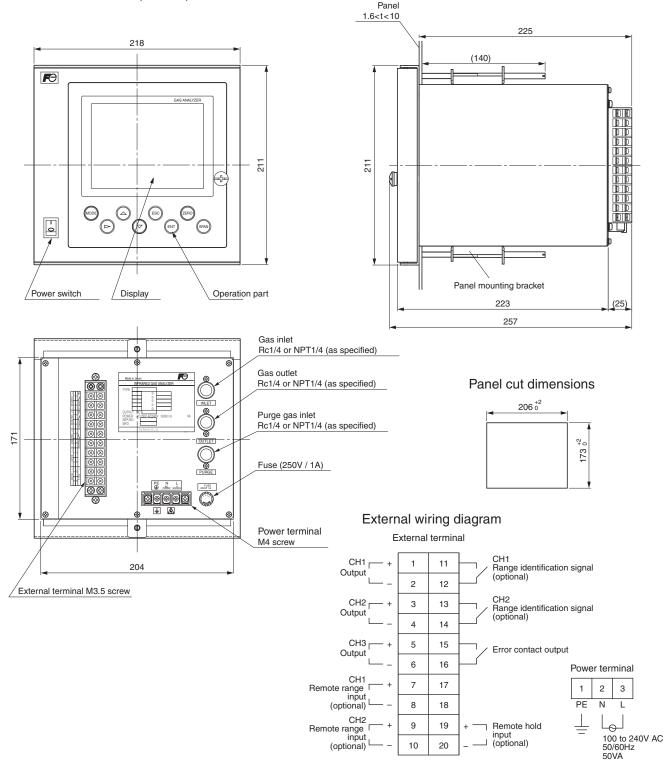

Scope of delivery:

Main unitPanel mounting bracket × 1 Power fuse × 2 (250V AC 1A) Instruction manual; 1 copy

Optional items:

Gas sampling device Standard gas Receiving instrument, etc

Ordering information

- 1. Type
- Application and composition of sample gas (in case of nonstandard)

Information in this catalog is subject to change without notice. Read the instruction manuals thoroughly before using the products.



Gate City Ohsaki, East Tower, 11-2, Osaki 1-chome, Shinagawa-ku, Tokyo 141-0032, Japan Phone: +81-3-5435-7111 www.fujielectric.com www.fujielectric.com/products/instruments/